

**PROPOSED PLAN OF REMEDIAL ACTION**


**1000 FRENCH STREET SITE  
Wilmington, Delaware**

**DE 1115**

SCANNED

JUN 16 1999

FILE # DE1115  
B8

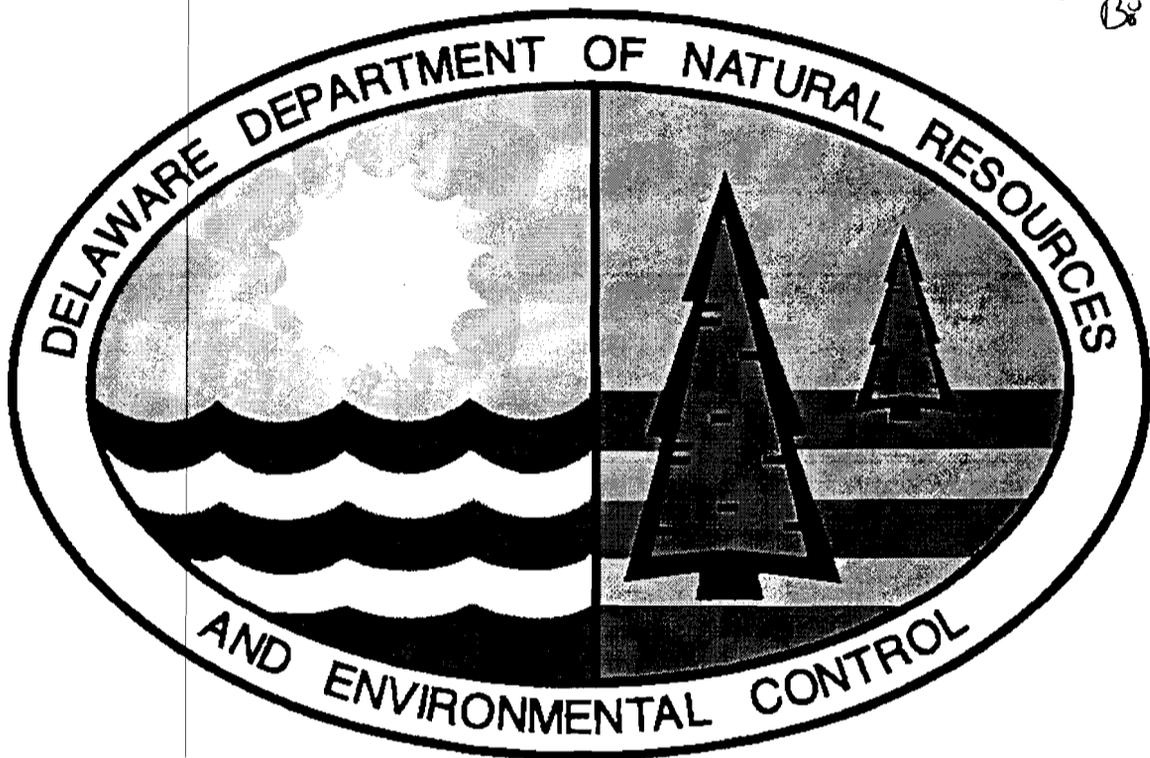

May 1999

**Department of Natural Resources and Environmental Control  
Division of Air and Waste Management  
Site Investigation and Restoration Branch**

## Table of Contents

I.	INTRODUCTION.....	1
II.	ORGANIZATION AND CONTENTS OF THE PROPOSED PLAN.....	1
III.	SITE DESCRIPTION.....	1
IV.	SITE HISTORY .....	2
V.	REMEDIAL INVESTIGATION PROCEDURES.....	3
VI.	REMEDIAL INVESTIGATION RESULTS .....	3
A.	GENERAL INFORMATION .....	3
B.	SITE FILL SOILS.....	3
C.	SUMMARY .....	3
VII.	INTERIM ACTION.....	4
VIII.	FACILITY REMEDIAL ACTION OBJECTIVES .....	4
IX.	RISK EVALUATION SUMMARY.....	4
X.	PROPOSED REMEDIAL ACTION PLAN .....	4
XI.	PUBLIC PARTICIPATION .....	5

## List of Figures

FIGURE I - SITE LOCATION.....	7
-------------------------------	---

## **I. Introduction**

The Delaware Department of Natural Resources and Environmental Control, Site Investigation and Restoration Branch (“DNREC-SIRB”) performed a Remedial Investigation (“RI”) of the 1000 French Street Site (“Site”) Wilmington, Delaware under the Delaware Hazardous Substance Cleanup Act (“HSCA”) 7 Del. C. Chapter 91. Based on the comprehensive environmental investigations performed for the Site and the interim action taken at the Site, DNREC-SIRB concluded that the Site, in its present condition, does not present an unacceptable risk to public health, welfare or the environment.

## **II. Organization and Contents of the Proposed Plan**

DNREC-SIRB issues this Proposed Plan under the provisions of HSCA and the Regulations Governing Hazardous Substance Cleanup, (“Regulations”). The Proposed Plan presents DNREC-SIRB’s assessment of the health and environmental risks posed by the Site and plans for limited further action.

In accordance with the Regulations, DNREC-SIRB hereby provides notice to the public and an opportunity for the public to comment on the Proposed Plan in accordance with Section 12 of the Regulations. At the comment period’s conclusion, DNREC-SIRB will review and consider all of the comments received and then DNREC-SIRB will issue a Final Plan of Remedial Action. The Final Plan of Remedial Action shall designate the selected remedy for the Site. The Proposed Plan, the comments received from the public, DNREC-SIRB’s responses to those comments, and the Final Plan of Remedial Action will constitute the remedial decision record.

The Regulations discuss the contents of the Proposed Plan of Remedial Action in Section 8 of the Regulations. The Proposed Plan contains a description of the following site information:

- A summary of the procedures, analytical results, and conclusions of the remedial investigation,
- A discussion of objectives,
- A summary of the risk assessment results, and
- A plan for the Site’s future.

## **III. Site Description**

The Site is located in the lot between Tenth, French, and Walnut Streets and St. Joseph’s Church in Wilmington, Delaware, New Castle County, see Figure 1. The Site consists of approximately 0.5 acres and consisted of 12 tax assessment parcels which have been consolidated into one tax parcel. The Site previously contained mixed uses including residential, commercial and industrial as well as a parking lot.

The Site is bounded to the north by St. Joseph’s Church and the church parking lot, to the east by Walnut Street, to the south by Tenth Street and to the west by French Street.

The Site is characterized by rolling hills and is underlain by the Wilmington Complex (a meta-igneous and meta-sedimentary crystalline “bedrock”) which is overlain by approximately 20 to 50 feet of sandy silt to silty clay material. Fracture orientation and frequency control

groundwater flow in this area. Well yields are generally low, with the average residential well yielding about one gallon per minute. Groundwater is also present in the overlying silty clay material (regolith). However, since the Site is located in the City of Wilmington, public water and sewer serves both the surrounding buildings and the Site.

Site surface elevations range from approximately 70 feet above Mean Sea Level (MSL) in the vicinity of Tenth and French Street to approximately 55 feet MSL at along Walnut Street. Surface drainage from the Site flows in an easterly to southeasterly direction toward the Brandywine Creek but intercepts the City of Wilmington combined sewage and stormwater collection system prior to reaching the Brandywine.

Soil Survey for New Castle County, Delaware describes the on-site soils as Made Land, which typically describes land that has been filled with soil materials, debris, or both. In addition, Made Land has been so altered or disturbed by urban works and structures that soil classification is not feasible.

There are no mapped wetland areas present on the Site. There are no wetland plants or hydrology present on the Site. Based on the review of the applicable FEMA Flood Insurance Rate Map, the Site is located in an area that is outside of the 500-year floodplain.

There are no underground storage tanks present on the Site.

#### **IV. Site History**

The Site contained a series of residential houses, small commercial operations and a parking lot.

Historic research indicates that residential buildings were present on the Site from 1884 through to the mid-1960s. In the late 1960s, some of the buildings were demolished into their own footprint. From the late 1960s until 1989, several residential buildings remained on the Site, with the remainder of the Site comprising a bituminous and concrete parking lot.

Potential asbestos containing materials were observed on the former residential buildings. All asbestos containing materials were abated properly from the buildings prior to the demolition and/or relocation of the buildings. The asbestos abatements were performed by a Delaware Certified Asbestos Abatement Contractor, under the review of a Delaware Certified Asbestos Consultant. The DNREC, Division of Air and Waste Management, Air Resources Branch, was properly notified of all the abatements.

Basement heating oil tanks were present in several of the residential houses prior to the demolition and/or relocation. These tanks were emptied, cleaned and removed by J&M Industries, Inc. a Delaware Certified Tank Removal Contractor. The DNREC, Division of Air and Waste Management, Underground Storage Tank Branch, was properly notified.

The Site is currently under the care of the Bracebridge Corporation, and is slated for redevelopment as an office type structure for daycare and other multi uses by the Bracebridge Corporation. The Bracebridge Corporation entered into a voluntary agreement with DNREC-SIRB to conduct an investigation and cleanup of the Site.

## **V. Remedial Investigation Procedures**

DNREC-SIRB conducted an extensive review of past investigations prepared for the Site. After review of the work conducted, DNREC-SIRB worked with Duffield Associates, Inc. (Duffield), the consultant for Bracebridge Corporation, to develop a Work Plan to address the following:

- Determine the presence or absence of contaminants in the historic fill, and if present, determine the contaminant fate and transport, and
- Determine the presence or absence of a source in the underlying soils and structure and if present to remove the source.

The Work Plan called for Duffield to perform the following tasks:

- Re-sample and analyze the Site fill soils;
- Develop a profile of the volume of material impacted;
- A risk assessment, if necessary, both human health and/or ecological, and
- A FS, if the Site poses unacceptable risk to human health and the environment to correct these risks.

## **VI. Remedial Investigation Results**

DNREC-SIRB considers the data and information generated in the previous investigations of the Site to meet the criteria of a RI. The following is a brief summary of the results of the investigations for the Site

### **A. General Information**

All surrounding buildings and structures are currently connected to public water and wastewater systems.

Asbestos materials were removed and disposed of properly prior to the demolition and/or relocation of the buildings located on the Site.

Basement heating oil storage tanks were cleaned and removed properly prior to the demolition and/or relocations of the buildings located on the Site.

### **B. Site Fill Soils**

Subsurface evaluation of the parcels not containing residential/commercial structures revealed buried debris and ash as well as historic fill. Elevated concentrations of metals and polynuclear aromatic hydrocarbons (PAHs) were reported in this fill material. Petroleum hydrocarbons were detected in fill soils along the northern boundary of Tenth and French Streets.

### **C. Summary**

The results of the study indicated that the Site contains elevated concentrations in the fill soils of lead, chromium and selenium, which exceeded the DNREC-SIRB Remediation Standards for unrestricted use. PAH compounds were detected in Site fill soils in all samples at

concentrations, which exceeded the Remediation Standards for unrestricted use. Petroleum is present in the soils beneath the eastern portion of the Site. And, buried debris and ash was observed to depths of up to six (6) feet below top of ground surface.

## **VII. Interim Action**

The agreement with Bracebridge Corporation provided that if during the course of investigation means became apparent to reduce the contamination or prevent its spread, appropriate action would be taken immediately. Therefore the following remedial interim actions have occurred:

- **Removal of Regulated Fill Soils:** These regulated fill soils were removed and disposed of properly as per the Regulations.

## **VIII. Facility Remedial Action Objectives**

The Regulations provide that DNREC-SIRB sets objectives for land use, resource use, and cleanup levels that are protective of human health and the environment. The following objectives are determined to be appropriate for the Site:

- Prevent residential exposure to impacted media, and
- Continue the use of public water and sewer for all purposes to the surrounding community,

These objectives are consistent with the value of the Site as part the surrounding land use, New Castle County zoning policies, state regulations governing water supply, and worker health and safety.

## **IX. Risk Evaluation Summary**

Duffield performed a health risk assessment to evaluate the possible effects on human health from the use of the Site consistent with the objectives discussed above.

The Risk Evaluation ("RE") evaluated whether there was a possible health risk and/or environmental impacts from the release of hazardous substances from the Site. Given that nearly all the residents in the immediate area are connected to municipal water supply and the interim action removed all soil contamination, there is no completed pathway for exposure for any potential ecological or human receptors in the area.

## **X. Proposed Remedial Action Plan**

Based on the results of the RI and the Interim Action at the Site, DNREC-SIRB concludes that the risks at the Site are acceptable with a restricted groundwater access. Therefore, DNREC-SIRB will:

- Restrict drinking water access and create a groundwater management zone for the Site.

## **XI. Public Participation**

DNREC-SIRB actively solicits public comments or suggestions on the Proposed Plan and welcomes opportunities to answer questions. Please direct written comments to:

Department of Natural Resources and Environmental Control  
Division of Air and Waste Management  
Site Investigation and Restoration Branch  
391 Lukens Drive  
New Castle, Delaware 19720-2774  
Attn: Jane Biggs Sanger

or call (302)395-2600. The public comment period for this Proposed Plan begins on June 5, 1999, and ends at the close of business (4:30 p.m.) June 25, 1999, if so requested, a public meeting will be held on the Proposed Plan. The meeting time and place will be announced if said meeting is requested.

JFBS/rm/JFB99031.DOC  
DE 1115 II B8